


MERITOR[®] CALIPER SERVICE KIT UPDATE

Service Kits for Meritor Calipers on Scania Applications

We are pleased to announce to you the latest additions to the Meritor Caliper Service Kits Range. These Service Kits are for service and repair of Meritor ELSA225 calipers fitted to Scania applications 2014 onwards.


Description		Axial Mounting Pad Carrier		Axial Mounting Pad Carrier		Tangential Mounting Pad Carrier	
Position		RH	LH	RH	LH	RH	LH
OE Caliper Ref		2272727	2272728	2499324, 2493085, 2564031, 573087	2499325, 2493084, 2564032, 573088	2564041, 2471416, 573045	2564042, 2471417, 573073
Meritor OE Caliper Ref		68034856	68034857	68035141, 68035125	68035142, 68035126	68035149	68035150
Fitment Dates		2014 - 03/2016		02/2016 >>		09/2016 >>	
Kit	Kit Contents	Kit Number					
Pad Retainer Kit	6, 7	MCK1519					
Housing Kit	9, 14	MCK1565	MCK1566	MCK1565	MCK1566	MCK1575	MCK1576
Bridge Kit	1	MCK1512 MCK1552			MCK1540		
Carrier Kit	2	MCK1513 MCK1635 MCK1636			MCK1636		
Guide Pin Kit	15, 16, 17, 22, 23, 24, 25	MCK1323					
Guide Pin Seal Kit	18, 21	MCK1310					
Piston Head Kit	19, 20	MCK1309					
Piston Seal Kit	19	MCK1139					
Visual Wear Indicator	8	MCK1311 Not fitted					

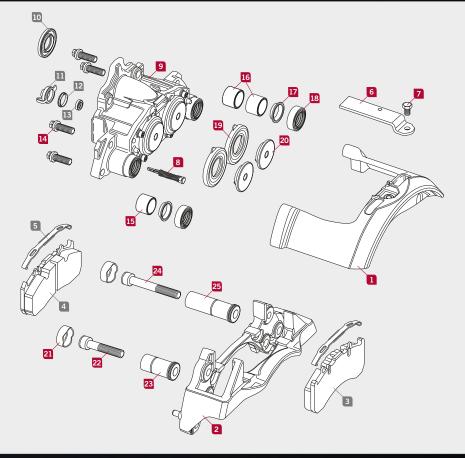


SERVICE KITS FOR MERITOR CALIPERS ON SCANIA APPLICATIONS

To aid identification of the caliper/pad carrier types:

Axial Pad Carrier

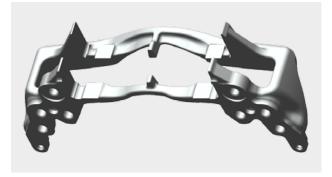

Tangential Pad Carrier

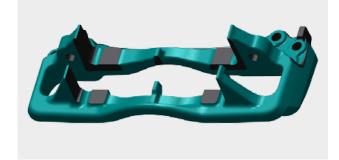

Guidance for replacement of Guide Pins

Please note than some Meritor calipers fitted to Scania applications have a special guide pin arrangement that uses a number of hardened steel balls to provide antirotation protection. For aftermarket replacement and service of the guide pins, these balls are not required, therefore Guide Pin Kit MCK1323 contains standard guide pins without the anti-rotation feature.



Please always refer to Meritor Maintenance Manual MM-0350 when servicing, repairing or replacing Meritor ELSA225 calipers.

Cross References

OE Reference	Meritor Sales Reference
2272616	MCK1519
2272619	MCK1565
2272622	MCK1566
2272635	MCK1513
2272638	MCK1323
2272642	MCK1310
2272699	MCK1309
2272703	MCK1139
2272715	MCK1311
2290799	MCK1512

OE Reference	Meritor Sales Reference		
2290800	MCK1512		
2499316	MCK1565		
2499318	MCK1566		
2499320	MCK1552		
2564023	MCK1565		
2564027	MCK1566		
2564028	MCK1323		
2564034	MCK1575		
2564037	MCK1576		



Meritor Aftermarket Europe Limited Unit 1 Broad Ground Road Lakeside Industrial Estate Redditch, Worcestershire B98 8YS, U.K. Tel: +44 (0) 1527 506300 or visit meritor.com

www.meritorpartsxpress.com/eu

